



Whenever the level falls near the lower level mark (2), check the brake pads for wear. Replace the pads with new ones if necessary. After bleeding air from the system, again check to determine that the fluid level is at the upper mark. If the level is low, fill the reservoir with DOT 3 BRAKE FLUID from a sealed container, to the proper level. Reinstall the diaphragm and washer, and tighten the reservoir cap securely.

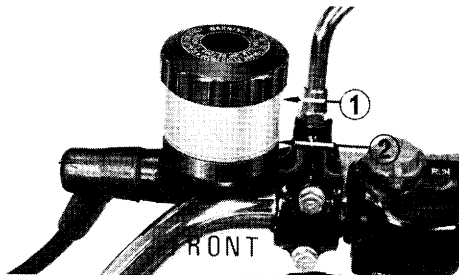

1 Upper level mark

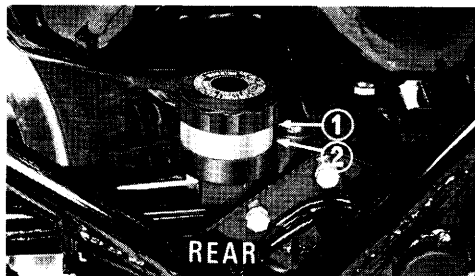

2 Lower level mark

If the brake pad wear does not exceed the limits, this will usually indicate fluid leak which should be repaired by a qualified Honda service technician. Consult nearest Honda dealer.

CAUTION: Before removing the reservoir cap always clean around it.
