

## Replacement

With the upper or lower section of drive chain tight between the sprockets measure the distance between a span of 21 pins from pin center to pin center. If the distance exceeds the service limit, the chain is worn out and should be replaced.

Service limit: 12.56 in (319.1 mm)

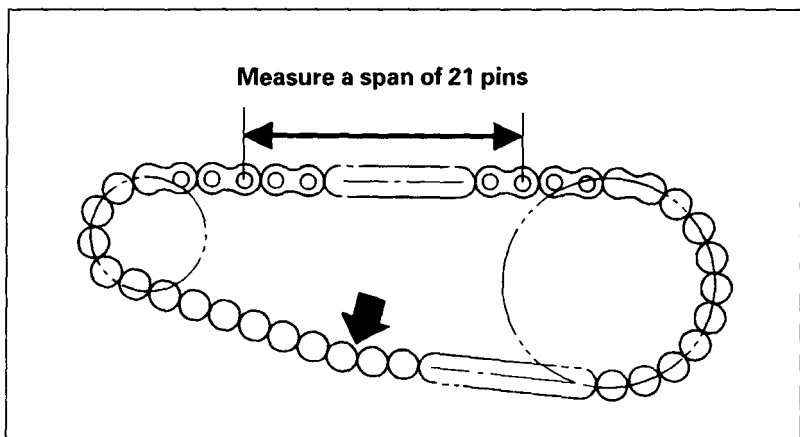


Fig. 4-17