


Inspection:

Check the coolant level in the reserve tank (1) when the engine is at normal operating temperature. If the level is below the UPPER mark (2), top-up with coolant. If there is no coolant in the reserve tank, check for leaks and repair as necessary.

Coolant change:

WARNING: Do not perform this operation while the engine is hot.

1. Remove the seat and left side cover.
2. Take out the reserve tank from the bracket and drain the coolant from it through the filler cap opening.

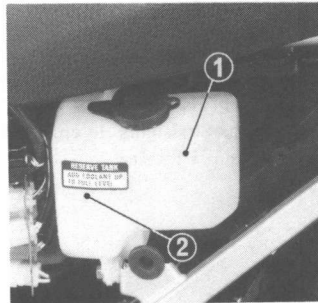

Inspection:

Vérifier le niveau du liquide de refroidissement du réservoir auxiliaire (1) lorsque le moteur est à la température normale de fonctionnement. Si le niveau est plus bas que le repère UPPER (2), faire le plein de liquide. S'il n'y a point de liquide dans le réservoir auxiliaire, vérifier pour détecter la fuite et la réparer s'il est nécessaire.

Remplacement du liquide refroidissement:

ATTENTION: Ne pas effectuer cette opération lorsque le moteur est chaud.

1. Déposer la selle et le cache latéral gauche.
2. Déposer le réservoir auxiliaire du support et vidanger le liquide de refroidissement du réservoir à travers l'ouverture du bouchon.