


Combination Meter Removal/Installation

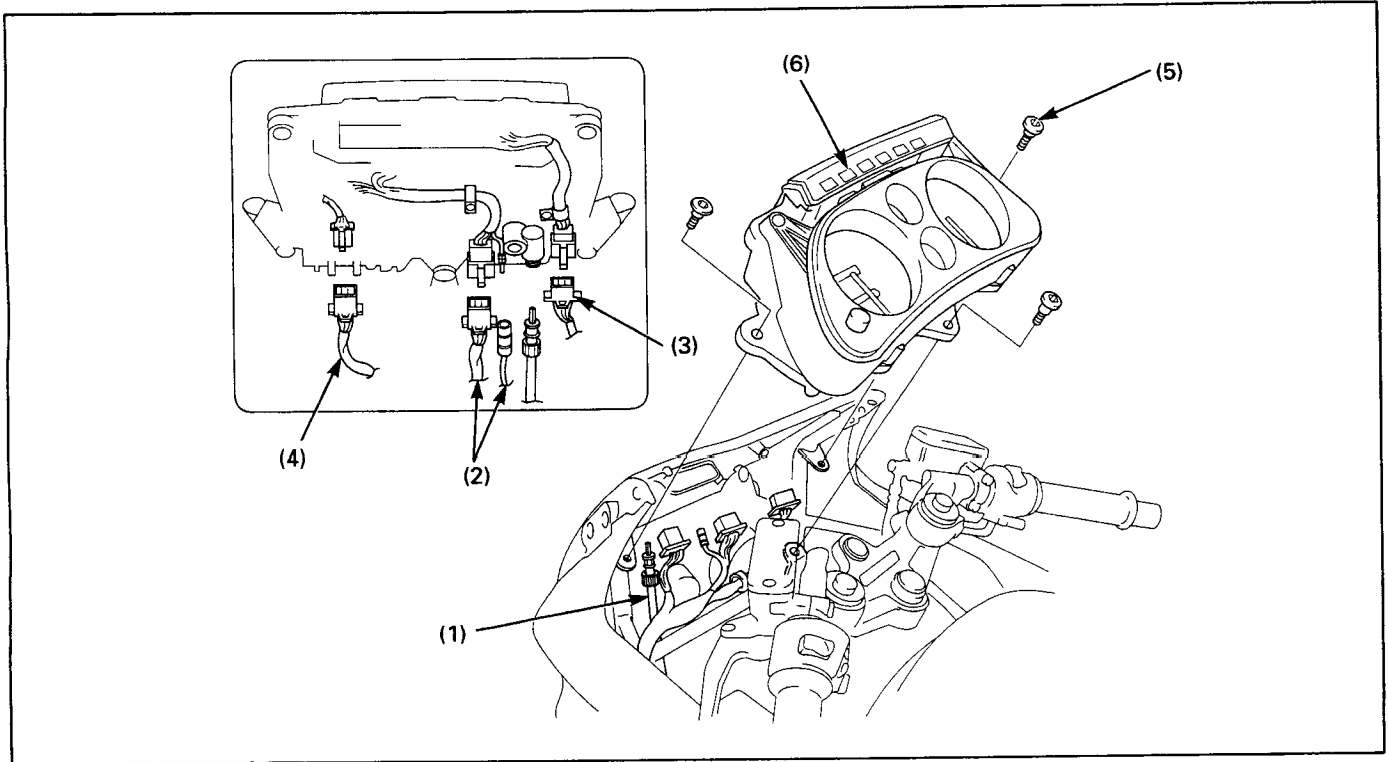

NOTE

- Route the wires and cable properly (page 1-23).

Requisite Service

- Windscreen removal/installation (page 2-7)

Procedure		Q'ty	Remarks
Removal Order			Installation is in the reverse order of removal.
(1)	Speedometer meter cable	1	
(2)	Combination meter 9P connector/ connector	1/1	
(3)	Combination meter 3P connector	1	
(4)	Position light 3P connector	1	Except U type
(5)	Combination meter mounting bolt	3	
(6)	Combination meter assembly	1	Disassembly (page 17-8)